


**EVOLINE** 

Tangential Knurling TK1–TK6 EVO  
Operating Instruction

Notes

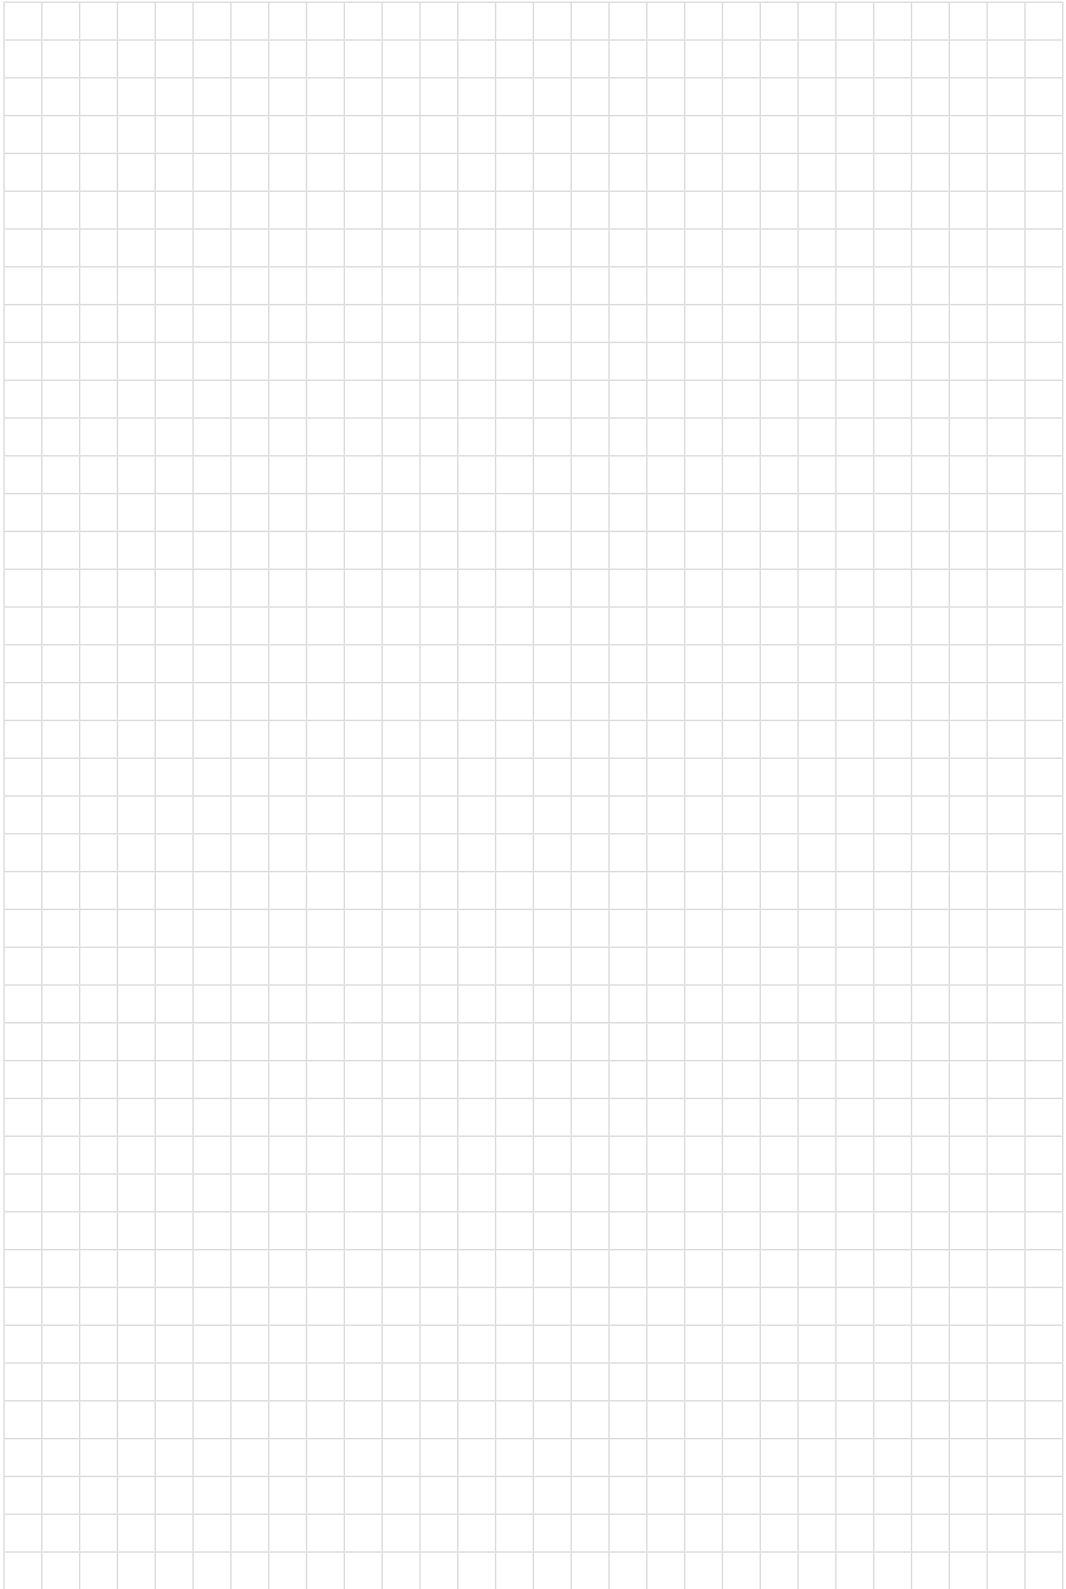

## Table of Contents

<b>A</b>	<b>Tables of Figures</b> .....	<b>2</b>
<b>B</b>	<b>List of Tables</b> .....	<b>2</b>
<b>1</b>	<b>General</b> .....	<b>3</b>
1.1	Introduction .....	3
1.2	Operator's obligation of diligence .....	4
1.3	Contact .....	4
1.4	Copyright .....	5
<b>2</b>	<b>Safety</b> .....	<b>5</b>
2.1	Explanation of symbols and instructions .....	5
2.2	Basic safety instructions .....	6
2.3	Intended use .....	7
2.4	Authorized personnel and responsibilities .....	9
<b>3</b>	<b>The rolling system</b> .....	<b>10</b>
3.1	Rolling Head .....	11
3.2	Rolling Head Holder .....	12
3.3	Rolls .....	13
3.4	Setting gauge .....	15
3.5	Dimensions of the <i>rolling system</i> .....	16
3.6	Working ranges and rollable materials .....	16
3.7	Tightening torques .....	17
3.8	Condition upon delivery .....	18
<b>4</b>	<b>Installation</b> .....	<b>19</b>
4.1	Machine requirements .....	19
4.2	Inserting the rolls into the <i>rolling system</i> .....	20
4.3	Adjusting the axle distance to workpiece dimension .....	22
4.4	Inserting the rolling head into the rolling head holder .....	23
4.5	Installing the <i>rolling system</i> in the processing machine .....	24
<b>5</b>	<b>Operation</b> .....	<b>25</b>
5.1	Preparing the workpiece .....	25
5.2	Rolling process and feed .....	27
5.3	Travels – set up the <i>rolling system</i> depending on the workpiece .....	29
5.4	Rolling speed and machine speed .....	30
5.5	Tangential force, driving power, torque and rolling time .....	32
<b>6</b>	<b>Disassembly after operation</b> .....	<b>34</b>
6.1	Removing the <i>rolling system</i> from the processing machine .....	34
6.2	Removing the rolls .....	35
6.3	Removing the rolling head holder .....	35
<b>7</b>	<b>Wear parts, parts list</b> .....	<b>36</b>
<b>8</b>	<b>Maintenance</b> .....	<b>38</b>
<b>9</b>	<b>Storage</b> .....	<b>38</b>
<b>10</b>	<b>Disposal</b> .....	<b>39</b>
<b>11</b>	<b>Troubleshooting</b> .....	<b>40</b>

## A Table of Figures

Figure 1:	The four components of the <i>rolling system</i> TK EVO. . . . .	10
Figure 2:	Labeling of the <i>rolling system</i> , rolling head and holder (Example: TK4 EVO) . . . . .	11
Figure 3:	Example of rolling head type TK EVO . . . . .	12
Figure 4:	Example of a rolling head holder according to DIN 6980. . . . .	13
Figure 5:	Labeling of the rolls . . . . .	13
Figure 6:	Setting gauge . . . . .	15
Figure 7:	Dimension of the <i>rolling system</i> . . . . .	16
Figure 8:	Sketched illustration of a <i>rolling system</i> on a turret . . . . .	20
Figure 9:	Inserting the rolls into the <i>rolling system</i> . . . . .	21
Figure 10:	Checking the rolls . . . . .	21
Figure 11:	Adjusting the axle distance to workpiece dimension. . . . .	22
Figure 12:	Degree of forming at the profile tooth . . . . .	22
Figure 13:	Inserting the rolling head into the holder . . . . .	23
Figure 14:	Checking the pendular play of the rolling head in the holder . . . . .	24
Figure 15:	Preparing the workpiece incl. undercut . . . . .	26
Figure 16:	The tangential rolling process . . . . .	28
Figure 17:	Creating the travel paths via calculated tooling lengths. . . . .	29
Figure 18:	Creating the travel paths using the setting gauge . . . . .	30
Figure 19:	Forces occurring during the tangential rolling process . . . . .	32
Figure 20:	Exploded view TK1 –TK6 EVO . . . . .	36

## B List of Tables

Table 1:	Roll version . . . . .	14
Table 2:	Dimensions of the rolling head TK EVO . . . . .	16
Table 3:	Working ranges of <i>rolling system</i> TK EVO . . . . .	16
Table 4:	Tightening torque . . . . .	17
Table 5:	Knurl profiles according to DIN 82. . . . .	26
Table 6:	Tooth height depending on the pitch . . . . .	27
Table 7:	Knurling pitch and working feed ( <i>AV</i> ). . . . .	27
Table 8:	Rolling speed. . . . .	31
Table 9:	Material constant $K_{WT}$ . . . . .	32
Table 10:	Components of the <i>rolling system</i> TK1 –TK6 EVO . . . . .	37
Table 11:	Cleaning and maintenance intervals . . . . .	38
Table 12:	Troubleshooting. . . . .	40

# 1 General

## 1.1 Introduction

The *rolling system* has been constructed according to the state of the art in accordance with the recognized safety rules and standards and manufactured in accordance with TÜV-CERT DIN ISO 9001 and VDA 6.4.

**The operating instructions apply solely to *rolling system* described in the operating instructions**

Terms in italics are defined as a collective term at the appropriate place:

- In using the collective term the information relates to all single terms.
- In using the singular term the information relates solely to the single term.



### NOTE

The collective term *rolling system* includes the single terms rolling head, all accessories, consumables, and spare parts.

The illustrations and information contained in these operating instructions are subject to technical changes that are necessary to improve the *rolling system*.



### NOTE

Modifications or amendments to these operating instructions made at a later time can be found online under [www.lmt-tools.de/dokumente-downloads](http://www.lmt-tools.de/dokumente-downloads).

The operating instructions are written with the intention to be read, understood and observed in all respects by those who are responsible for the use of the *rolling system*.

A safe and error-free use of the *rolling system* is only possible if the contents of the operating instructions are understood by the competent persons and observed in all respects.



### NOTE

Work instructions are supplemented by position numbers.  
Compare the information with the figure in Chapter 7.

Improper use of the *rolling system* can endanger people and cause property damage. No liability shall be assumed for any damage or malfunctions resulting from failure to observe these operating instructions.



### NOTE

Note all warnings and safety instructions and the operating instructions for the machine.

### Storage of the operating instructions

The entire operating instructions must be stored carefully and always kept with the *rolling system* as part of the product.

The operating instructions must be kept near the *rolling system* so that they are available to all persons working with the *rolling system* as required.

## Warranty and technical support

We guarantee proper function of the delivered product with purchase.

We are not liable for damage in case of:

- Improper use of the *rolling system*.
- Use of non-original components.
- Use of accessories not authorized by us.
- Modifications undertaken without our authorization.
- Use of damaged components.

Modifications to the components are permitted only after written agreement with us.

We undertake modifications to the *rolling system* to adapt the *rolling system* to the requirements of the operator. We inform the operator of the modifications and impact on the use of the *rolling systems*. The operating instructions describe the use of a *rolling system* without modifications.

**If you encounter any problems or have any questions, please contact our Service Hotline, which will be glad to help.**

We offer training specially tailored to your needs for your staff at your site. We also hold regular seminars in the LMT Group Academy, our subsidiaries and representatives.

## 1.2 Operator's obligation of diligence

The operator of the *rolling system* must ensure that

- The intended use of the *rolling system* is ensured at all times.
- The *rolling system* is always in a perfect and functioning condition.
- Only qualified and authorized personnel assemble and operate the *rolling system* in accordance with these operating instructions.
- The qualified and authorized personnel are regularly informed about all these necessary rules of occupational safety and environmental protection.
- The qualified and authorized personnel are informed in detail about modifications made and their impact.
- There is sufficient necessary protective equipment for the qualified and authorized personnel that is in good condition and that such equipment is worn.
- The operating instructions are available in legible condition and in full at the installation site of the *rolling system*.

## 1.3 Contact

### Service-Hotline:

Team Rollen  
Grabauer Strasse 24  
21493 Schwarzenbek  
Germany  
Tel.: +49 4151 12 391  
Fax: +49 4151 12 502  
teamrollen@lmt-tools.com

### Postal address:

LMT Fette Werkzeugtechnik  
GmbH & Co. KG  
Postfach 1180  
21484 Schwarzenbek

### Delivery address:

LMT Fette Werkzeugtechnik  
GmbH & Co. KG  
Grabauer Strasse 24  
21493 Schwarzenbek  
Germany

### LMT Group Academy:

Grabauer Strasse 24  
21493 Schwarzenbek  
Germany  
Tel.: +49 4151 12 225  
Fax: +49 4151 1277 225  
academy@lmt-group.com

### Our homepage is:

[www.lmt-tools.com](http://www.lmt-tools.com)



## 1.4 Copyright

The copyright of these operating instructions remains with LMT Fette Werkzeugtechnik GmbH & Co. KG.

These operating instructions include regulations and technical drawings, which may be neither duplicated in full or in part, distributed or utilized for the purpose of competition or communicated to others.

Disclosure to third parties is not permitted.

We do not allow copying of the *rolling systems* or parts of the *rolling systems*.

## 2 Safety

### 2.1 Explanation of symbols and instructions

All safety instructions and warnings in the operating instruction are structured as follows:



#### **Danger level/Signal word**

Type and source of the danger  
Measures to avoid danger

#### **Hazard symbols**

The operating instructions differentiate between three hazard symbols, which allow an initial allocation of hazards. The yellow triangle indicates a general risk to people, property, animals or the environment.



#### **Danger level**

General danger to people, property, animals or the environment from the *rolling system*.  
Measure to avoid the danger

The red, octagonal hazard symbol with the signal word IMPORTANT indicates a potentially harmful situation for the *rolling system*. Observing the operational steps, guidelines and instructions avoids damage to or destruction of the *rolling system*.



#### **IMPORTANT**

A potentially harmful situation for the *rolling systems*.

Fellow all operational steps, guidelines and instructions in order to avoid damage or destruction to the *rolling system*.

The third hazard symbol with the signal word NOTE indicates important information and tips for the user.



#### **NOTE**

No direct danger

Important information and additional tips for the user on using the *rolling system*.

### Danger levels/Signal word

In the case of the yellow triangle the danger level indicates the degree of danger. Three danger levels are used. Each word is characterized by a color that illustrates the danger levels.

#### ■ CAUTION

The danger level indicates a hazard with a low level of risk which, if not avoided, may result in slight or moderate injury.


#### ■ WARNING

The danger level indicates a hazard with a medium level of risk which, if not avoided, may result in death or serious injury.


#### ■ DANGER

The danger level indicates a hazard with a high level of risk which, if not avoided, will result in death or serious injury.

Example:

DANGER	
	General risk due to the use of the <i>rolling system</i> by unqualified or unauthorized personnel.
	Use of the <i>rolling system</i> only by qualified and authorized personnel.

## 2.2 Basic safety instructions

DANGER	
	General danger when using the <i>rolling system</i> .
	Follow the operating instructions.
	These include
	■ The basic safety instructions from the entire chapter 2 for the entire operating instructions,
	■ The preceding instructions for a particular chapter and
	■ The embedded instructions for a particular step.
	Follow all local health and safety and operational safety regulations.

Chapter 2, Safety, informs you about the basic safety instructions to ensure safe and trouble-free use of the *rolling system*.

- Please contact the operator in the event of any changes to the *rolling system*.
- Refrain from any methods of working which could compromise safety.
- Only ever perform work on the rolling system when the machine is at standstill and if necessary take the *rolling system* out of the machine room.
- Before starting work on the *rolling system*, secure the drives and additional devices of the machine against accidental activation.
- Make sure there is sufficient space in the machine and pay attention to the risk of injury originating from adjacent tools and machine parts.
- Before any commissioning, check that the screws on the *rolling system* are tightened.



**WARNING**



The *rolling system* is made of various materials (e.g. nickel), which can trigger an allergic reaction. General risk of injury from sharp edges.

Wear protective gloves and protective eyewear when using the *rolling systems*.

The weight of the *rolling system* may cause harm when it falls down.

General risk of injury during transportation/lifting of the *rolling system*.

- Ensure that the *rolling system* is protected of falling down or tipping over.
- Wear safety boot/hard-toed boot at all times.
- Use suitable hoisting devices.

### 2.3 Intended use



**IMPORTANT**

The *rolling system* may only be used for the intended use.

Make sure that the *rolling system* is free of chips at all times.

Never apply force when using the *rolling system*.

The *rolling system* must only be used as a tool on a processing machine for chip-free manufacture of profiles on the outside of rationally symmetrical work pieces.



**NOTE**


Note that the *rolling system* is customized to the requirements specified by the operator.

Please contact our Service Hotline if you wish to use the *rolling system* in any way other than the agreed use.

The scope of application for the *rolling system* is to carry out a *rolling process*.

The *rolling process* includes the following manufacturing processes:

- Knurling
- Smoothing and
- Cold forming of rotationally symmetrical workpieces, to produce other profiles.

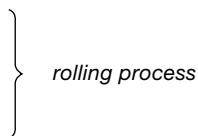

**NOTE**

The collective term *rolling process* includes the production processes of knurling, smoothing and cold forming of rotationally symmetrical workpieces for manufacturing other profiles.

Smoothing is a surface compression.

Sizing by smoothing, to perform a tolerance constriction, is not possible.



**IMPORTANT**

Be sure to use a torque wrench for all work on the rolling head and observe the tightening torque for each bolt (see chapter 3.7).



**NOTE**

Use other than the intended use is only allowed after written agreement with us.

Any use other than the intended use is considered improper use. We shall not be liable for any damage resulting from improper use. The risk is borne by the operator.

Intended use includes the observance of these operating instructions.

**Coolants and lubricants**

Liquids that are also used during machining are suitable as coolants and lubricants:

- Emulsions in dilutions ranging from 1: 10 to 1:20 (in some cases with high-pressure additives),
- Low viscosity cutting oils and
- Molybdenum (IV) sulfide.



**NOTE**

Observe the information and instructions provided by the manufacturer.

You can increase the service life of the rolls by using high-pressure additives, because high-pressure additives improve the sliding characteristics between the rolls and the workpiece.

Please contact our Service Hotline if you want to undertake dry processing with the *rolling system*.



**IMPORTANT**

Ensure that the cooling lubricant is free from chips or particles to prevent foreign bodies from being rolled into the thread and to prevent undue wear of the thread rolls and of the rolling head.

The rolling process is negatively affected by strong presence of swarf. Make sure that the rolling head is connected to the central lubrication/cooling system of the processing machine.

Install the rolling head into the processing machine in such a way as to ensure minimum exposure to chips directly. The chip guard included in the delivery should be used.



**IMPORTANT**

Only use coolants and lubricants for the *rolling system* that meet the above mentioned properties in order to avoid corrosion of the *rolling system*.

Observe the stated storage temperature and relative humidity in order to prevent corrosion on the *rolling system*.

## Reasonably foreseeable misuse

Reasonably foreseeable misuse of the *rolling system* includes:

- Use of the *rolling system* by non-qualified or unauthorized personnel.
- Leaving tools in the *rolling system*.
- Over rolling the thread.
- Rolling outside of the permissible rolling speed.
- Rolling outside of the permissible operating range.
- Non-compliance with the operating instructions.



### IMPORTANT

Avoid any reasonably foreseeable misuse of the *rolling system*.  
We are not liable for damage resulting misuse.

## 2.4 Authorized personnel and responsibilities

### DANGER



General risk due to the use of the *rolling system* by unqualified or unauthorized personnel.  
Use of the *rolling system* only by qualified and authorized personnel.

### Authorized personnel

- The *rolling system* may only be used by qualified and authorized personnel. These personnel must have received special instruction from the operator about possible hazards.
- The complete operating instructions must be read and understood by every person who deals with the use of the *rolling system*. We recommend the operator has this confirmed in writing.
- The qualification includes at least one mechanical technical training. In addition, we recommend staff training given by us at your site, training in our LMT Group Academy, our subsidiaries or our local representatives.
- The operator is responsible for ensuring that work is undertaken by staff being trained only under the supervision of qualified and authorized personnel.
- The operator is responsible for ensuring that unauthorized persons have no access to the *rolling system* under any circumstances.

### Responsibilities

- The operator must define all responsibilities for the use of the *rolling system* so that there are no ambiguities in terms of responsibility for safety aspects.
- The operator must clearly define the responsibilities of the personnel for each of the activities on the *rolling system*.

### 3 The rolling system

The *rolling system* forms the required profile in the workpiece with tangential feed direction. The rolling process is performed by chipless cold forming.

#### The moduls of the *rolling system*.

The *rolling system* consists of four components:

- Rolling head (1)
- Rolling head holder (2)
- Rolls (1 set = 2 pieces) (3)
- Setting gauge (4)

The four components of the *rolling system* TK EVO are shown in figure 1:

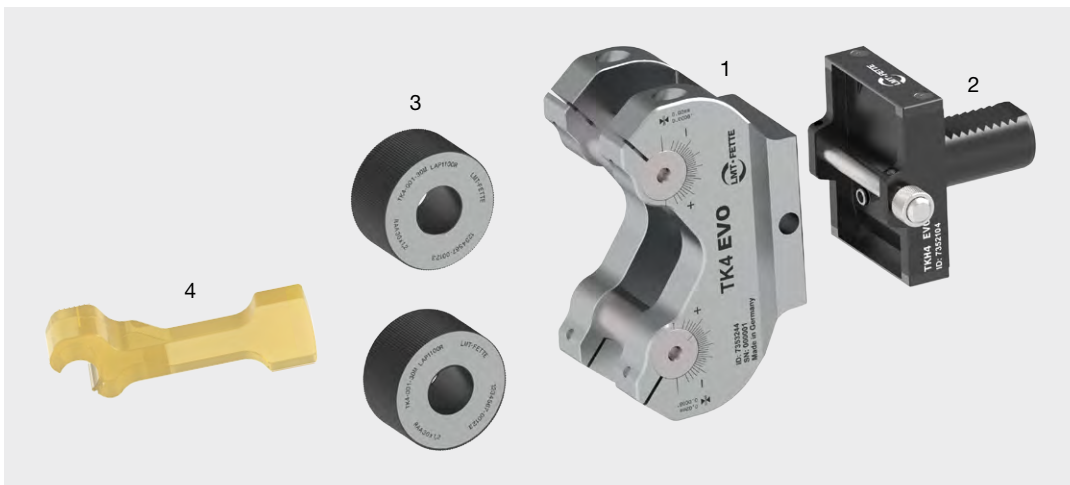


Figure 1: The four components of the *rolling system* TK EVO

The components of the *rolling system* are customized in order to fulfill the requirements of the specific application. Therefore each component is supplied separately.

### Labeling of the *rolling system* (rolling head and holder)

The labeling of the *rolling system* is placed on the outer surfaces of the main bodies. (see Figure 2).

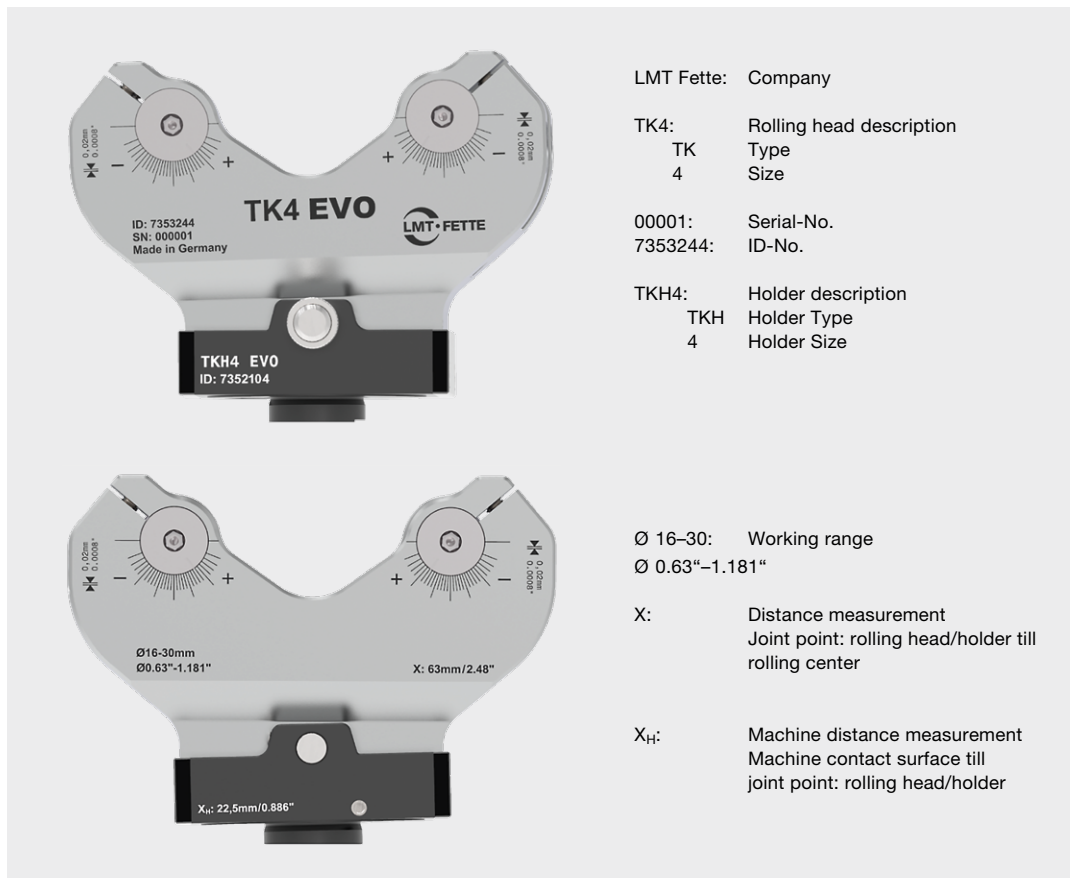


Figure 2: Labeling of the *rolling system*, rolling head and holder (Example: TK4 EVO)

## 3.1 Rolling Head

The rolling head is the centerpiece of a *rolling system*. The present version is available in six different sizes:

- TK1 EVO
- TK2 EVO
- TK3 EVO
- TK4 EVO
- TK5 EVO
- TK6 EVO

- Special designed rolling head are labeled in same manner, but are complemented by the letter „X“ and a consecutively number.

The rolling head stores the rolls and comes with a joint point in order to be assembled with a machine adaptation respectively rolling head holder (see Figure 3).



Figure 3: Example of rolling head type TK EVO



**NOTE**

Considering the used machine and the rolling head dimension we advise to choose the rolling head who will operate within the lower 2/3 of its working range.

### 3.2 Rolling Head Holder

Please note that due to the different versions of processing machines specifically adapted rolling head holder are available.

For information about suitable rolling head holders for your processing machine, please contact our Customer Service (see chapter 1.3). Our employees have extensive experience in installing our *rolling systems* and will be pleased to help you define the right rolling head holder for your processing machine.

We recommend using the rolling head holder with a chip guard (see Figure 4, No. 13) to protect the area between the rolling head and the rolling head holder.

The following rolling head holder types are suitable:

- VDI according to DIN 69880 (Example in Figure 4)
- Roundshank

Cross slide holder or similar on request.



Figure 4: Example of a rolling head holder according to DIN 69880

### 3.3 Rolls



**IMPORTANT**

Use rolls only in the sets delivered by us. Do not combine rolls from different sets.  
Check that the roll set number (serial number) is the same.

#### Labeling of the rolls

- Profile description
- Rolling head type
- Code number
- Roll width
- Roll version
- LMT material code (roll material)
- Company
- ID number
- Serial number

Depending on the roll size, the rolls are labeled either on one or more sides.  
Figure 5 shows an example of the labeling of the rolls.

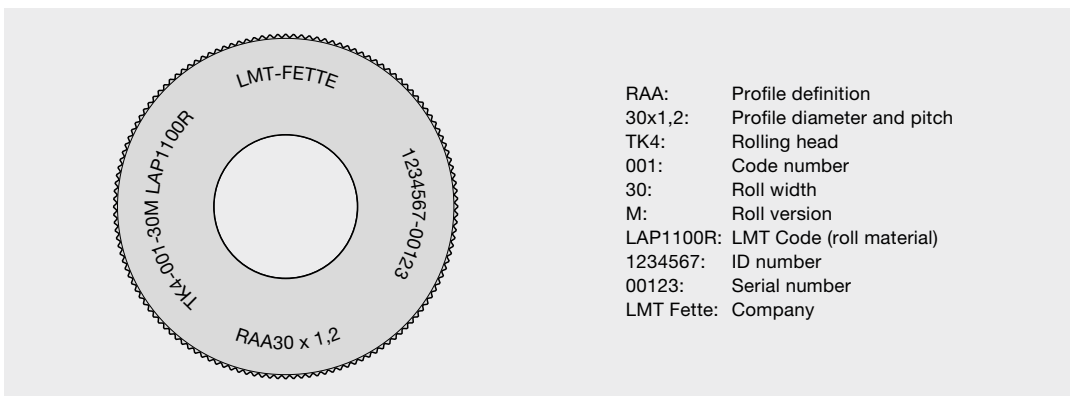


Figure 5: Labeling of the rolls

## Roll versions

Depending on the application, the rolls are available in different versions (see table 1).



### NOTE

The standard version is full roll width.

Roll version				
full roll width	A	B	M	AB
code number (example)				
TK4-33-26	TK4-33-12A	TK4-33-12B	TK4-33-12M6	TK4-33-12A-6B
A	AV	M	MV	
code number (example)				
TK4-77-12A	TK4-77-12AV	TK4-77-12M6	TK4-77-12MV6	

Table 1: Roll version

## Tool life

The tool life of the rolls is influenced by the following factors:

- Material properties (particularly tensile strength and elongation at fracture)
- Hardness increase behavior of the material under cold forming
- Degree of roll out of the profile
- Execution of chamfers during workpiece preparation
- Correct adjustment of the tool
- Rolling speed and operating feed
- Sufficient supply of clean coolant
- Avoidance of chips on workpieces and rolls prior to the rolling process
- Profile roll start and run-out

Review your application and discuss it with our personnel (chapter 1.3). They will be pleased to give you useful advice with regard to the ideal design of your roll. When the rolls are worn, they must be replaced with new ones.



### 3.4 Setting gauge

The setting gauge is customized and has the following tasks:

- Preadjustment of the axle distance in the rolling head
- Adjustment of the cross stroke in the processing machine

Depending on the size of the setting gauge it is inscribed by the following information:

- Company
- Profile description
- Code number (rolling head type and roll code number)
- Roll width
- Setting values  $F$  und  $A_v$
- ID number

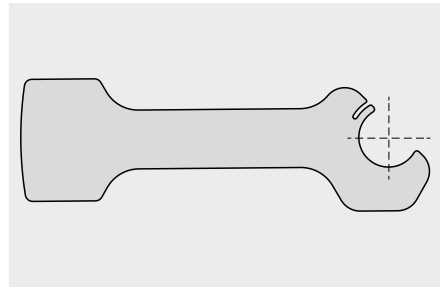


Figure 6: Setting gauge

### 3.5 Dimensions of the rolling system

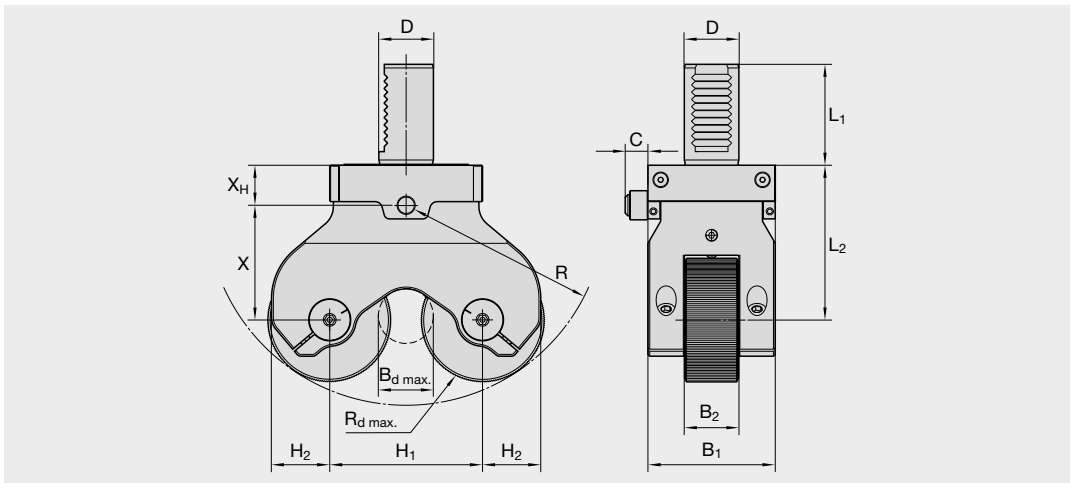


Figure 7: Dimension of the rolling system

Rolling head-type	TK1 EVO	TK2 EVO	TK3 EVO	TK4 EVO	TK5 EVO	TK6 EVO
Ident number	7368881	7368882	7368883	7368884	7368885	7368886
Construction dimensions	[mm   Inch]					
B <sub>1</sub>	42   1.654	48   1.889	64   2.520	70   2.756	70   2.756	70   2.756
B <sub>2</sub>	14   0.551	20   0.787	25   0.984	30   1.181	30   1.181	30   1.181
L <sub>1</sub>	48   1.889	48   1.889	48   1.889	48   1.889	48   1.889	48   1.889
L <sub>2</sub>	59   2.323	63.5   2.500	79   3.110	87   3.425	87   3.425	110.5   4.350
C	10   0.394	10   0.394	10   0.394	10   0.394	10   0.394	10   0.394
X <sub>H</sub>	19   0.748	19   0.748	21   0.827	22.5   0.886	22.5   0.886	23   0.906
X	39   1.535	46.5   1.831	58   2.283	63   2.480	77   3.031	90   3.543
H <sub>1</sub>	38   1.520	52   2.047	68   2.677	84   3.307	104   4.094	126   4.961
H <sub>2</sub>	23.5   0.959	20   0.787	26   1.024	32   1.260	35   1.378	35   1.378
R	60   2.362	74   2.913	95   3.740	110   4.331	132   5.197	150   5.906
R <sub>dmax.</sub>	35   1.378	43   1.693	57   2.244	69   2.717	79   3.110	82   3.228
B <sub>dmax.</sub>	20   0.787	24   0.945	32   1.259	42   1.654	60   2.362	82   3.228
D	20; 30; 40; 50 0.787; 1.181; 1.575; 1.968		30; 40; 50; 60   1.181; 1.575; 1.968; 2.362			
m-Rs	2 kg   4.4 lb	3 kg   6.6 lb	5 kg   11 lb	7 kg   15.4 lb	8.5 kg   18.7 lb	11 kg   24.2 lb

Table 2: Dimensions of the rolling head TK EVO

### 3.6 Working ranges and rollable materials

Working ranges for knurls, form beads and burnishing						
Knurling head	Major-Ø		Pitch		max. profile depth	max. profile width
	[mm   Inch]					
TK1 EVO	4–16	0.157–0.630	0.5–2	0.02–0.079	2   0.079	14   0.551
TK2 EVO	8–22	0.315–0.866	0.5–2	0.02–0.079	2   0.079	20   0.787
TK3 EVO	12–30	0.472–1.181	0.5–2	0.02–0.079	3   0.118	25   0.984
TK4 EVO	16–38	0.630–1.496	0.5–2	0.02–0.079	3   0.118	30   1.181
TK5 EVO	26–58	1.024–2.283	0.5–2	0.02–0.079	3   0.118	30   1.181
TK6 EVO	45–80	1.772–3.149	0.5–2	0.02–0.079	3   0.118	30   1.181

Table 3: Working ranges of rolling system TK EVO

### Rollable materials

A large number of characteristics and properties influence the rollability of materials and the resulting profile quality.

In order to reduce the complexity the chosen properties:

- Elongation and
- Tensile strength

enable an evaluation of the rollability of materials suitable for everyday use.



#### IMPORTANT

The following property values aren't hard limits, rather empirical values who define the feasible.

Metallic materials with the following properties can be rolled with a *rolling system* TK EVO:

- Elongation  $\sigma_B \geq 7\%$  und
- Tensile strength  $\sigma_Z \leq 1000$  MPa

Please contact our Service Hotline if you wish to perform rolling processes outside of these limits or very near them.

### 3.7 Tightening torques



#### IMPORTANT

Observe the tightening torques.

Dimensions	Tightening torque
M3	1.28 Nm
M4	2.97 Nm
M5	3.03 Nm
M6	10.25 Nm
M8	24.93 Nm
M10	49 Nm
M12	86 Nm

Table 4: Tightening torque

### 3.8 Condition upon delivery

We deliver your *rolling system* in the following condition separately:

- The rolling head with tools (without set of rolls)
- The rolling head holder
- The set of rolls
- The setting gauge



#### NOTE

Please note that the delivered components are matched to the size of the *rolling system*. Only use the supplied components for the delivered *rolling system*.

The condition upon delivery is the proper storage condition.

#### CAUTION



The components of the *rolling system* are sprayed with a commercially available creeping oil to protect them against corrosion. Touching the oily surface of the components may result in skin irritations. Avoid skin contact, especially in case of allergies or open skin lesions.

Do not touch the oiled surface if you have an open lesion. Do not touch the oiled surface if you are worried about an allergic reaction. Call the service hotline to find out the contents of the creeping oil and check your tolerability.

## 4 Installation



### IMPORTANT

Please contact our Service Hotline in the event of initial installation of the *rolling system*.

We will gladly advise you on:

- Inserting the rolls into the *rolling system*,
- Functional testing of the *rolling system*,
- Inserting the rolling head into the rolling head holder, and
- Installing the *rolling system* into the processing machine.

### WARNING



General risk of injury from sharp edges.

The *rolling system* is made of various materials (e.g. nickel), which can trigger an allergic reaction.

Wear protective gloves and protective eyewear when using the *rolling systems*.

The weight of the *rolling system* may cause harm when it falls down.

General risk of injury during transportation/lifting of the *rolling system*.

- Ensure that the *rolling system* is protected of falling down or tipping over.
- Wear safety boot/hard-toed boot at all times.
- Use suitable hoisting devices.

### 4.1 Machine requirements

#### Collision check

### WARNING



General risk of collision.

Don't equip the machine with a *rolling system* without a collision check.

Please contact our Service Hotline in the event of initial equipment or change of a *rolling system* on your machine. We will be happy to guide you through.

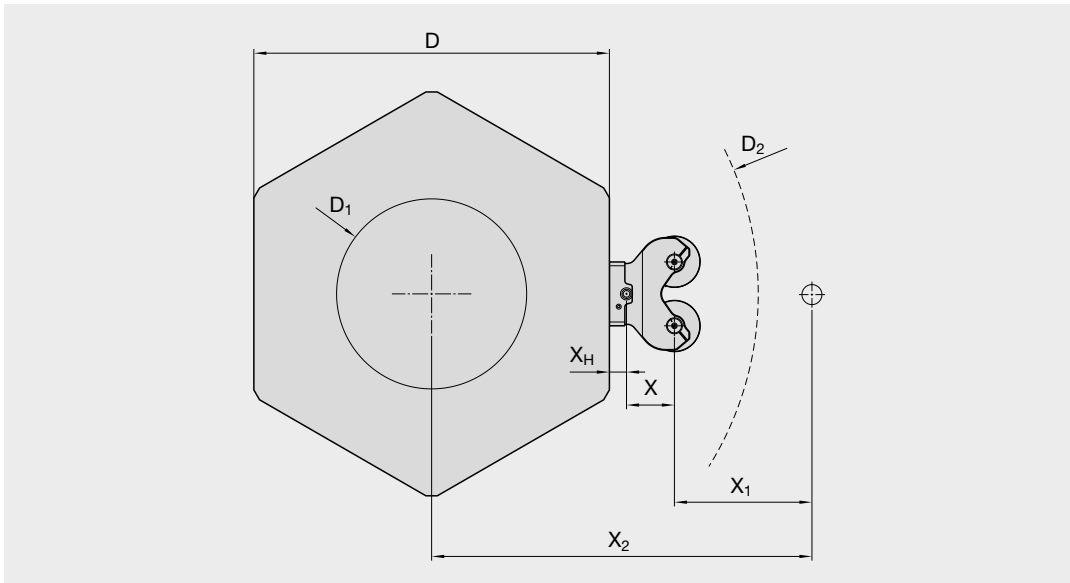


Figure 8: Sketched illustration of a *rolling system* on a turret



**NOTE**

$D$ : Turret outside dimensions

$D_1$ : Inner turret dimensions

$D_2$ : Max. swing circle-Ø

$X_2$ : Turret center to workpiece center

$X_1$ : Travel

$X_H$ : Machine contact surface till joint point: rolling head/holder

$X$ : Joint point: rolling head/holder till rolling center (workpiece center)

For a collision-free use of the *rolling system* dimensions must lay be within the max. swing circle-Ø.

See chapter 3.4 for *rolling system* dimensions.

## 4.2 Inserting the rolls into the *rolling system*

1. Loosen the clamping screws (3) and remove the roll axis (2).



**IMPORTANT**

In order to ensure a good friction coefficient between roll (8) and roll axis (2), be sure to lubricate sufficiently the roll bore and the roll axis in the region in the region of the roll and the pinion using molybdenum sulfide grease. (e.g. Molykote).

2. Lubricate sufficiently the bore of the roll with molybdenum sulfide grease.
3. Place the rolls into the main body (in arbitrary order) with matching boreholes.
4. Push the roll axis (2) with the small-Ø ahead in to the main body's bigger borehole until it is flush.
  - 4.1 The marking line on the roll axis front side should point to the "+" side of the scale.
5. Fix the roll axis in position with the clamping screw (3).

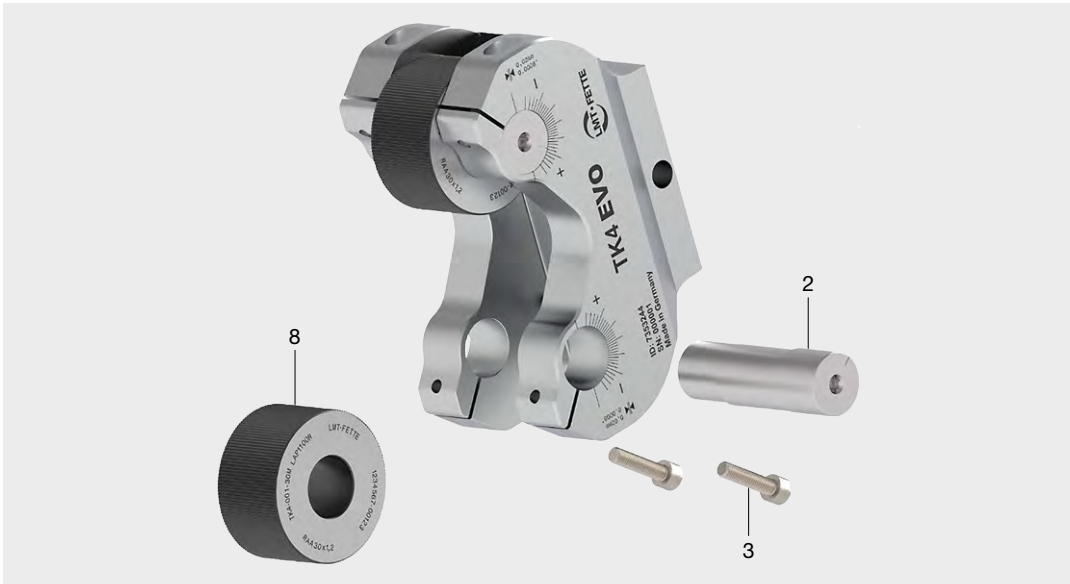


Figure 9: Inserting the rolls into the rolling system

### Checking the rolls

Move or rather rotate the rolls in order to check a smooth-running.



Figure 10: Checking the rolls



#### IMPORTANT

Contact our Service Hotline if you can't move the rolls.



#### CAUTION

General risk of component breakage.

Don't do a roll process if you can't move the rolls.

### 4.3 Adjusting the axle distance to workpiece dimension

The eccentric roll axis (2) are used to adjust the axle distance to workpiece dimension.

1. Loosen the clamping screw (3).
2. Place the setting gauge (9) between the rolls (8) and adjust the roll axis (2) in the manner that the rolls touch the reference plane on the setting gauge slightly (see figure 7). We advice to adjust both roll axis evenly so that both marking lines are on the same scale position on each arm of the main body (1).
3. Fix the roll axis in position with the clamping screw (3)

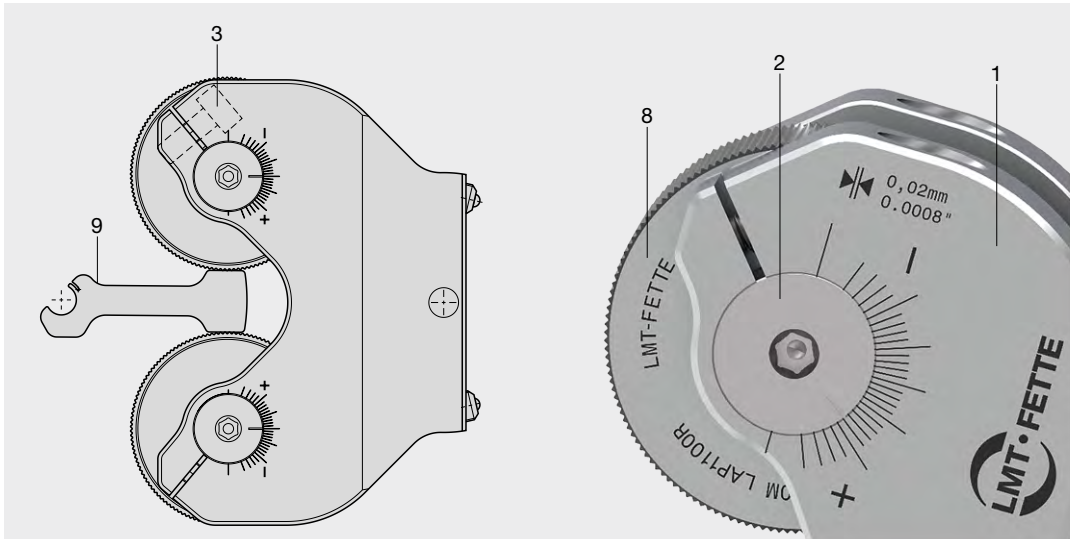


Figure 11: Adjusting the axle distance to workpiece dimension



#### IMPORTANT

Don't perform a second rolling process on a once rolled profile.

Following our installation instructions you will produce a non-completely formed profile tooth.

If the core/middle diameter is too large or the external diameter too small, make the following adjustments:

1. Decrease the axle distance. This makes the rolling head narrower and the core diameter smaller.
2. As a result of reducing the axle distance, more material is pressed into the tooth crest. This automatically increases the external diameter of the thread.

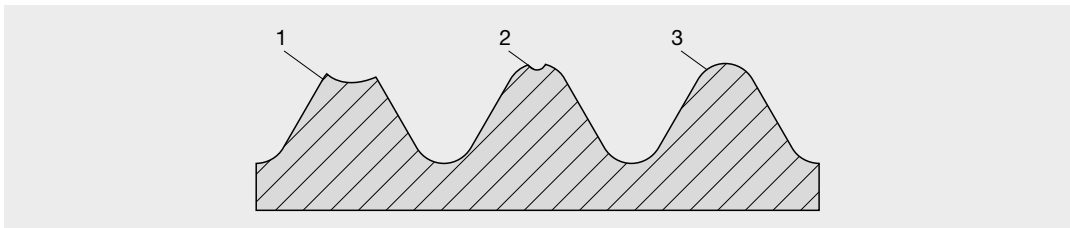


Figure 12: Degree of forming at the profile tooth



Closely inspect the rolled profile. Figure 12 shows the possible degrees of forming of a profile tooth:

- Tooth 1 represents a profile tooth that is **not completely formed**. This degree of forming normally yields a stable profile. In most applications this degree of forming is aimed for.
- Tooth 2 represents a thread tooth that is **completely formed**. This degree of forming is used to meet the highest requirements in optics and tightness.
- Tooth 3 represents a profile tooth that is **overformed**.



**NOTE**

After rolling, the workpiece external diameter  $d$  must not have a burnished finish and must not be overformed in the profile crests. This leads to increased roll wear.

#### 4.4 Inserting the rolling head into the rolling head holder

The rolling head is delivered with spring plungers (7) which are set at our factory (don't move them). You can insert and mount the rolling head without any additional tools.

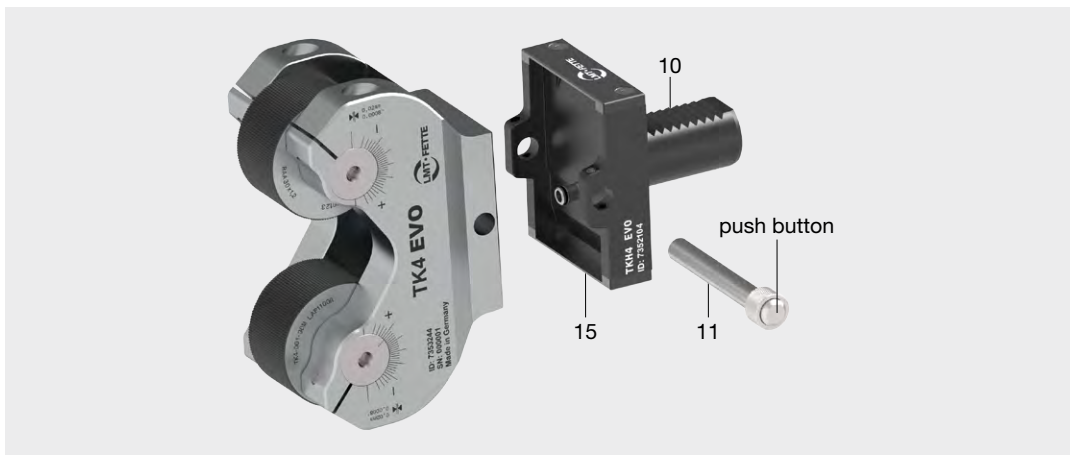


Figure 13: Inserting the rolling head into the holder

1. Push the button on the shaft (11) and pull the shaft (11) out of the holder (10).
2. Insert the rolling head into the holder in the manner that the coolant pipe (15) matches the determined borehole in the rolling head.



**NOTE**

We recommend to grease the o-ring (mounted on the coolant pipe (15) with customary silicone grease.

3. Push the button on the shaft (11), plug the shaft fully into the holder (10) and let go of the push button. Make sure that the quick-release balls of the shaft snap into the locking boreholes. You may have to rotate the shaft in the mounted position until the quick-release balls engage.



**IMPORTANT**

The push button jumps slightly upwards when the quick-release balls engage successfully. Check if the shaft (11) is secured in position by attempting to pull the shaft out of the holder.

4. Hold the holder tight and check the pendular play of the rolling head in the holder, by moving the rolling head as shown in figure 14.



Figure 14: Checking the pendular play of the rolling head in the holder

## 4.5 Installing the *rolling system* in the processing machine

### WARNING



General risk of injury from sharp edges.

The *rolling system* is made of various materials (e.g. nickel), which can trigger an allergic reaction.

Wear protective gloves and protective eyewear when using the rolling systems.

The weight of the *rolling system* may cause harm when it falls down.  
General risk of injury during transportation/lifting of the *rolling system*.

- Ensure that the *rolling system* is protected of falling down or tipping over.
- Wear safety boot/hard-toed boot at all times.
- Use suitable hoisting devices.

1. Check if you need suitable hoisting device.
2. Insert the *rolling system* in the processing machine.
3. Fix and secure the mounting position of the *rolling system*.

### Shank according to DIN 69880

Using a rolling head holder with a shank according to DIN 69880 on a turret, the correct alignment within the machine is via DIN 69880 ensured.

### Roundshank

In the case of using a round shank the entire *rolling system* is turned in position and then clamped. For centering, the *rolling systems* is moved against the initial diameter on the workpiece. The *rolling system* is turned until both rolls touch the initial diameter simultaneously.

## 5 Operation



### IMPORTANT

First follow the instruction in chapter 4, installation.  
Please contact our Service Hotline in the event of initial commissioning of the *rolling system*.

We will gladly advice on:

- Preparing the workpiece,
- Defining the process variables and
- Fine-adjusting the *rolling system*.

### WARNING



General risk of injury from sharp edges.

The *rolling system* is made of various materials (e.g. nickel), which can trigger an allergic reaction.

Wear protective gloves and protective eyewear when using the *rolling systems*.

The weight of the *rolling system* may cause harm when it falls down.

General risk of injury during transportation/lifting of the *rolling system*.

- Ensure that the *rolling system* is protected of falling down or tipping over.
- Wear safety boot/hard-toed boot at all times.
- Use suitable hoisting devices.

### 5.1 Preparing the workpiece

#### Blank diameter

- For standard knurling use following formula:



#### NOTE

$$d_v \approx d - h_z$$

$d_v$ : Blank diameter [mm]

$d$ : Nominal diameter [mm]

$h_z$ : Tooth depth according to DIN 82 [mm] – see table 6

The resulting blank diameter must be complied with a tolerance of  $-0.02$  mm.

#### Chamfer

- The chamfer angle should be  $\gamma = 10^\circ - 30^\circ$ .
- The interior diameter  $d_1$  must be smaller than the core diameter.



#### NOTE

$$d_1 \leq d_3 - 0.1 \text{ mm}$$

$d_1$ : Interior diameter [mm]

$d_3$ : Core diameter [mm]

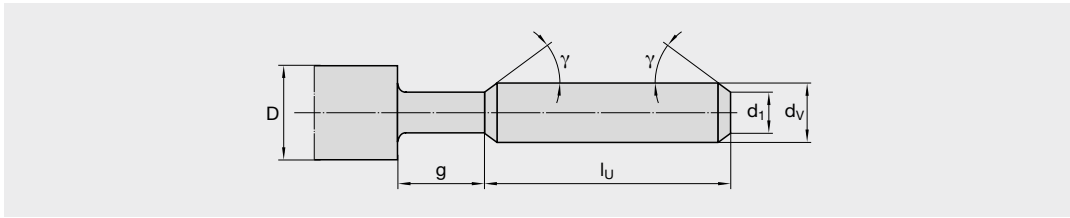


Figure 15: Preparing the workpiece incl. undercut



**NOTE**

- $g$ : Undercut (profile outlet) [mm]
- $\gamma$ : Chamfer angle [°]
- $D$ : Shoulder diameter [mm]
- $d_1$ : Interior diameter [mm]
- $d_v$ : Blank diameter [mm]
- $l_u$ : Profile length

Knurls according to DIN 82 (see table 5) can be manufactured with *rolling system* type TK EVO.

Knurl				
		$d_1$ = Nominal diameter $d_2$ = Pre-diameter $t$ = Pitch  Standard pitch $t$ : 0.5   0.6   0.8   1.0   1.2   1.6 mm		
Form	RAA	RBL	RBR	RGE
Nomination	Knurls with axially parallel grooves	Left-hand knurl	Right-hand knurl	Left-hand/ right-hand knurls, points raised
Illustration				

Table 5: Knurl profiles according to DIN 82

In the following table are the commonly used pitch and tooth heights with the pressure angle 90° shown.

Pitch t in mm	Tooth height in mm
0.5	0.23
0.6	0.25
0.8	0.37
1.0	0.47
1.2	0.50
1.5	0.64
1.6	0.75
2.0	0.95

Table 6: Tooth height depending on the pitch

## 5.2 Rolling process and feed

Tangential-Knurling *rolling systems* are designed to be operated on CNC lathe and multi spindle machines by using the plunge cutting method. Therefore the profile lengths is limited to the roll widths. In general the tangential rolling process consist the following process steps:

**approach fast feed → work cycle slow feed → return fast speed**

Each step is shown in figure 16. Make sure that the fast feed approach is finished before the beginning of the work cycle. The working feed is the theoretical travel “AV” of the *rolling system* from the moment of initial contact of the rolls on the workpiece diameter all the way up to the end position of the work cycle. The working feed (AV) is shown in the table below. The precise “Av” value of an specific application is written on the setting gauge. The actual working feed should be completed within  $W = 20$  workpiece rotations.

Working feed depending on the pitch (AV)								
Rolling head	Knurling pitch t in mm							
	0.5	0.6	0.8	1.0	1.2	1.5	1.6	2.0
TK1	6.327	6.404	6.850	7.202	7.304	7.766	8.112	8.710
TK2	6.327	6.404	6.850	7.202	7.304	7.766	8.112	8.710
TK3	7.525	7.617	8.144	8.559	8.680	9.226	9.634	10.338
TK4	8.361	8.462	9.046	9.507	9.641	10.245	10.696	11.475
TK5	9.478	9.592	10.253	10.773	10.925	11.607	12.117	12.995
TK6	10.236	10.359	11.072	11.633	11.796	12.531	13.081	14.028

Table 7: Knurling pitch and working feed (AV)

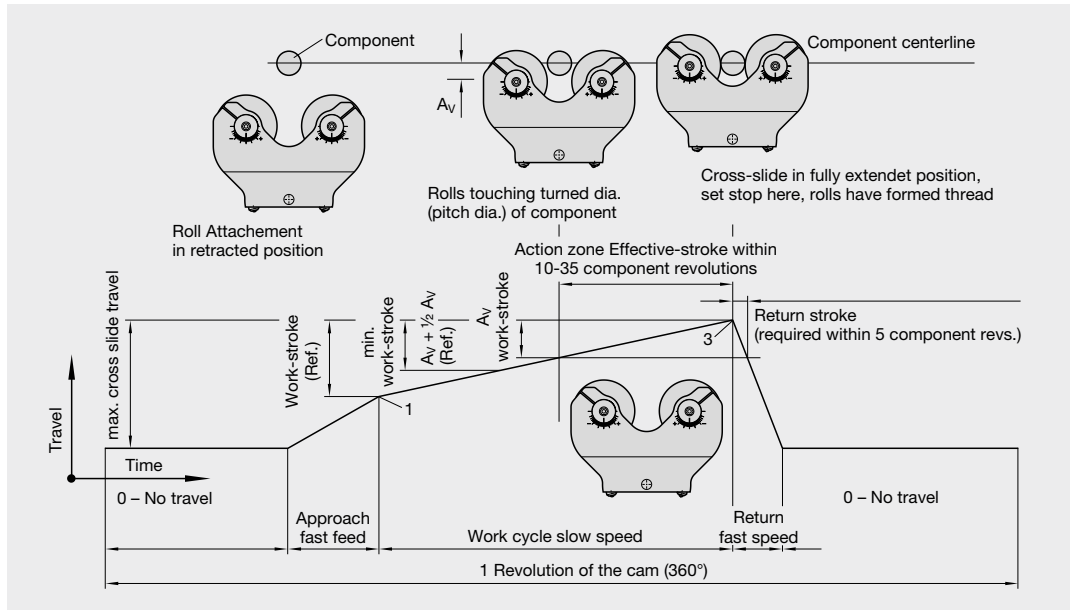


Figure 16: The tangential rolling process

### Operating feed

Calculate the operating feed  $f$  and the feed rate  $f_v$  as follows:

#### CAM controlled machines:

$$f = \frac{A_v}{n_w} \text{ [mm/rev.]}$$

#### non-CAM-controlled machines:

$$f_v = \frac{A_v \cdot n}{n_w} \text{ [mm/min]}$$



#### NOTE

$f$ : Operating feed [mm/U]  
 $f_v$ : Feed rate [mm/min]  
 $n$ : Machine speed [ $\text{min}^{-1}$ ]

$n_w$ : Workpiece revolutions  
 $A_v$ : Working stroke [mm]



#### NOTE

RAA type knurls require faster operation feed than usual knurls.  
We recommend for RAA type knurls:

- Operation feed: 1.0–1.5 mm/revolution and
- Workpiece revolution:  $W = 10–15$ .

### 5.3 Travels – set up the *rolling system* depending on the workpiece

To determine the tooling length you can use a formula or use the setting gauge to set up the *rolling system*.

#### Calculating the tooling length

The tool length is calculated using the following formula:

$$l_w = X_H + X$$



#### NOTE

The measures  $X_H$  and  $X$  are labeled on the rolling head and the holder.

$l_w$ : Tool length [mm]

$X_H$ : Machine contact surface till joint point: rolling head/holder

$X$ : Joint point: rolling head/holder till rolling center (workpiece center)



#### IMPORTANT

Note that the tool length  $l_w$  is merely the theoretical tool length.

Inspect the travel paths for problematic geometries by running them slowly without workpiece.

#### Creating the travel paths using the calculated tooling lengths

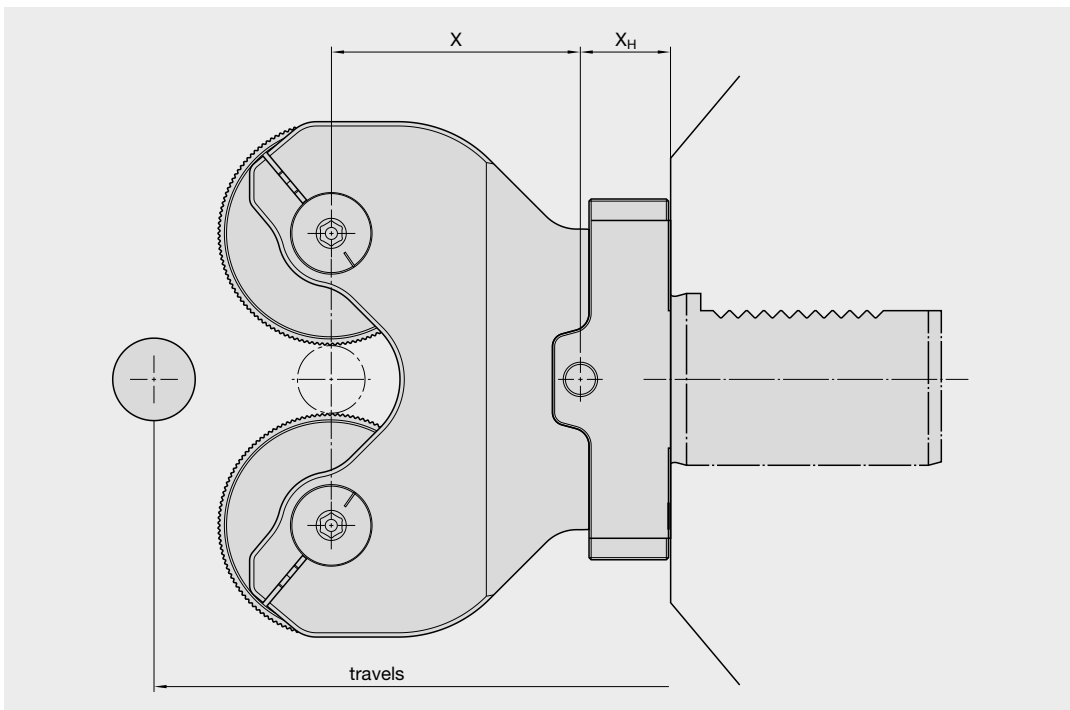


Figure 17: Creating the travel paths via calculated tooling lengths

### Creating the travel paths using the setting gauge

1. Install the rolling head holder into the processing machine.
2. Clip the setting gauge on the shaft (11).
3. Move the rolling head holder with the setting gauge towards the workpiece until the leading edge of the setting gauge touches the blank diameter  $d_A$  of the workpiece, This position is equivalent to the end point of the travel path. The rolling head must not be moved farther towards the workpiece. Particularly in cam-controlled machines, a fixed stop must be set here.

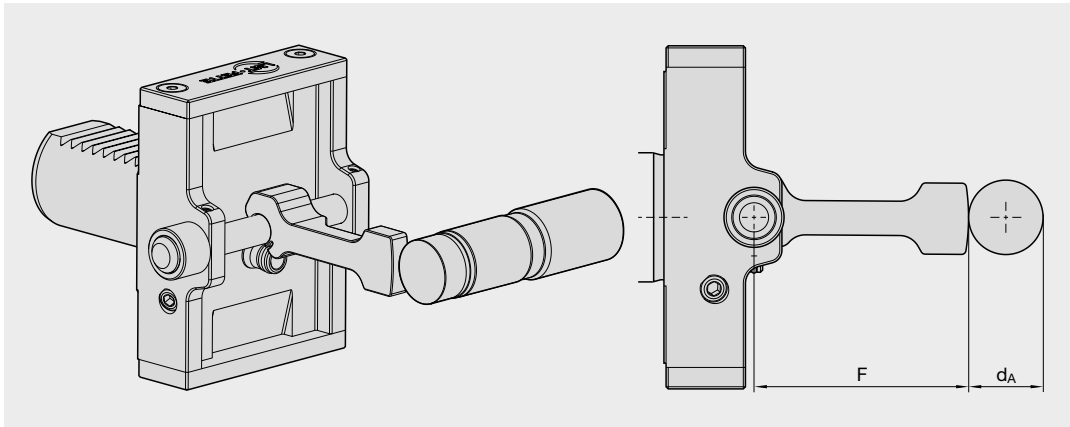


Figure 18: Creating the travel paths using the setting gauge

## 5.4 Rolling speed and machine speed

### Rolling speed



#### NOTE

Determine the rolling speed depending on the material using the table 8.

### Tensile strength (yield) and elongation at fracture of the material:

For materials with high tensile strength, operate at 20–30 m/min. Bear in mind that the rolling speed depends on the tensile strength. Choose low rolling speeds for high tensile strength, and for low tensile strength choose high rolling speeds.

### Machine speed



#### NOTE

The machine speed is calculated as follows:

$$n = \frac{1000 \cdot v}{d_A \cdot \pi} \quad n = \frac{1000 \cdot v}{d_A \cdot \pi} \quad [\text{min}^{-1}]$$

$n$ : Machine speed [ $\text{min}^{-1}$ ]

$v$ : Rolling speed [m/min]

$d_A$ : Blank diameter [mm]



	Steel grade	Tensile strength N/mm <sup>2</sup>	Abbreviation	Material number	Rollability	Rolling speed	
						m/min	ft/min
Ferrous metals	General structural steels	500	S235JRC	1.0120	☺	40-80	130-265
		500- 600	S550GD	1.0531	☺	30-60	100-200
		750- 900	C50	1.0540	☺	20-50	65-165
		630- 850	C45E	1.1191	☺	20-50	65-165
	Case hardening steels	590- 780	C15E	1.1141	☺	40-70	130-230
		780-1080	16MnCr5	1.7131	☺	30-50	100-165
	Nitriding steels	780	34CrAl6	1.8504	☺	20-50	65-165
		900-1300	31CrMoV9	1.8519	☺	20-40	65-130
	Free cutting steels	350- 530	10S10	1.0711	☺	30-60	100-200
		360- 760	11SMnPb30	1.0718	☺	30-60	100-200
		590- 830	35S20	1.0726	☺	30-60	100-200
	Heat treatable steels	630- 780	C35	1.0501	☺	40-70	130-230
		850-1000	C60E	1.1221	☺	30-60	100-200
		1100-1300	42CrMo4	1.7225	☺	20-50	65-165
		1250-1450	30CrMoV9	1.7707	☹	20-40	65-130
		1200-1400	34CrNiMo6	1.6582	☹	20-40	65-130
		1100-1300	51CrV4	1.8159	☹	20-40	65-130
	Tool steels	800- 850	X210Cr12	1.2080	☺	30-50	100-165
		800-1000	X130W5	1.2453	☺	20-40	65-130
		760- 810	115CrV3	1.2210	☺	30-50	100-165
	High speed steels	920	HS6-5-2C	1.3343	☹	20-40	65-130
		880	HS6-5-2-5	1.3243	☹	20-40	65-130
	Stainless steels	650- 730	X12Cr13	1.4006	☺	30-50	100-165
		800- 950	X17CrNi16-2	1.4057	☺	30-50	100-165
		650- 850	X14CrMoS17	1.4104	☺	30-50	100-165
		500- 700	X5CrNi18-10	1.4301	☺	35-55	115-175
		500- 750	X8CrNiS18-9	1.4305	☺	35-55	115-175
		500- 700	X5CrNiMo17-12-2	1.4401	☺	30-50	100-165
		500- 700	X6CrNiMoTi17-12-2	1.4571	☺	30-50	100-165
	Cast steels	380- 530	GE200	1.0420	☺	40-60	130-200
		540	G36Mn5	1.1176	☺	40-60	130-200
		1000-1200	G50CrMo4	1.7232	☺	30-50	100-165
Malleable cast iron	450	EN-GJMB-450-06	EN-JM 1140	☺	30-60	100-200	
	650	EN-GJMB-650-02	EN-JM 1180	☺	30-60	100-200	
Cast iron	400	EN-GJS-400-15	EN-JS 1030	☺	30-60	100-200	
	500	EN-GJS-500-7	EN-JS 1050	☺	30-50	100-165	
	600	EN-GJS-600-3	EN-JS 1060	☺	30-50	100-165	
High temperature materials	≥ 970	NiCo20Cr20CoMoTi (Nimonic 263)	2.4650	☺	30-50	100-165	
	700- 950	NiMo16Cr15W (Hastelloy C276)	2.4819	☺	20-40	65-130	
Nickel alloys	580- 800	NiCr15Fe (Inconel 600)	2.4816	☹	20-40	65-130	
Non-ferrous metals	Copper	240-300	E-Cu	CW004A	☺	40-80	130-265
	Copper alloys (Brass)	310	CuZn37	CW508L (R310)	☺	40-80	130-265
		410	CuZn38Pb2	CW608N (R410)	☺	40-70	130-230
		360	CuZn38Pb2	CW608N (R360)	☺	40-70	130-230
		430	CuZn39Pb3	CW614N (R430)	☺	40-70	130-230
	Aluminum alloys	150- 240	AlMg2	EN AW-5251	☺	40-70	130-230
		160- 310	AlSi1MgMn	EN AW-6082	☺	40-70	130-230
		220- 350	AlZn4,5Mg1	EN AW-7020	☺	30-50	100-165
		220- 440	AlCu4Mg1	EN AW-2024	☹	30-50	100-165
		275- 540	AlZn5,5MgCu	EN AW-7075	☺	30-50	100-165
	Titanium alloys	390- 540	Ti2	3.7035	☺	30-60	100-200
		540- 650	TiCu2	3.7124	☺	30-60	100-200
		750- 950	TiAl5Sn2,5	3.7115	☺	30-60	100-200
		1030-1100	Ti6Al4V	3.7164.7	☺	20-40	65-130

Table 8: Rolling speed

## 5.5 Tangential force, driving power, torque and rolling time

### Tangential force

The rolling head works with plunging cutting method. The two rolls move laterally over the workpiece. The roll profile penetrates tangentially into the workpiece, creating the desired shape. The processing machine generates the tangential force  $F_T$ . The rolling head absorbs the radial force  $F_R$ .

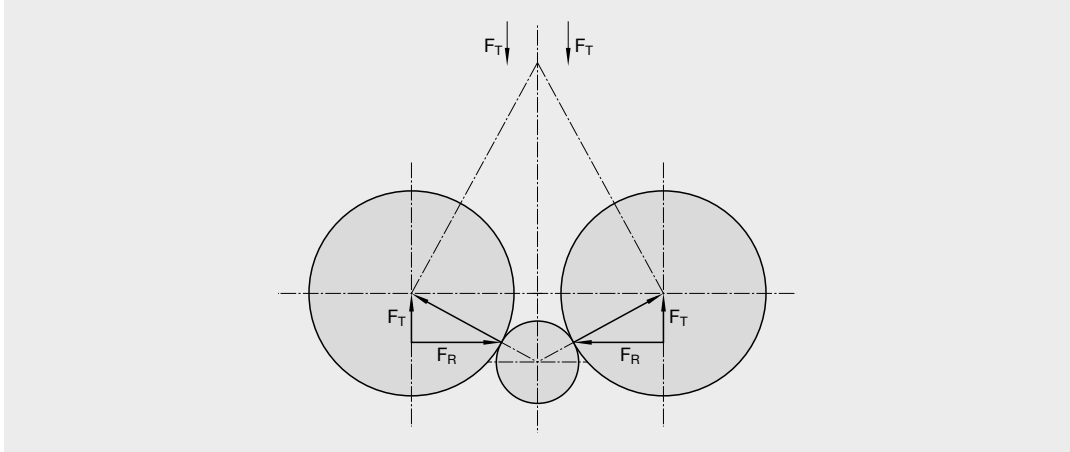


Figure 19: Forces occurring during the tangential rolling process

In the case of hydraulically or electrically driven slides check the maximum tangential force. Calculate the tangential force  $F_T$  as follows:

$$F_T = \frac{2340 \cdot L \cdot K_{WT}}{n_w} (0.06 \cdot d^{0,82} + 0.46 \cdot P - 0.1 \cdot Z + 1) \text{ [N]}$$



#### NOTE

- $F_T$ : Tangential force [N]
- $F_R$ : Radial force [N]
- $L$ : Profile lengths [mm]
- $K_{WT}$ : Material constant
- $n_w$ : Workpiece revolutions
- $d$ : External diameter [mm]
- $P$ : Pitch (profile depths) [mm]
- $Z$ :  $\frac{\text{Roll-}\varnothing}{\text{Workpiece-}\varnothing}$

The material constant  $K_{WT}$  is derived from the following table:

Tensile strength $R_M$ of the workpiece [N/mm <sup>2</sup> ]	$K_{WT}$
0–500	1
500–700	1.2
700–900	1.3
> 900	1.4
Copper	1.1
Brass	0.9

Table 9: Material constant  $K_{WT}$



**NOTE**

Increase the number of workpiece revolutions in order to get a lower tangential force.

Calculate the driving power and torque as follows:

**Driving power**

$$N = 0.105 \cdot 10^{-5} \cdot n \cdot F_T \text{ [kW]}$$

**Torque**

$$M = 0.01 \cdot F_T \text{ [Nm]}$$



**NOTE**

$n$ : Machine speed [ $\text{min}^{-1}$ ]

$F_T$ : Tangential force [N]

$N$ : Driving power [KW]

$M$ : Torque [Nm]

## 6 Disassembly after operation



### IMPORTANT

Please contact our Service Hotline in the event of dismantling:

- Removing the *rolling system* from the processing machine.
- Dismounting the rolling head.
- Dismounting the rolling head holder.
- Dismounting the thread rolls.

Check all modules of the *rolling system* for wear and damage.

Please contact the operator if you notice wear or wear on a component of the *rolling system*.

### CAUTION



Risk of injuries the hands!

During decommissioning, dismantling or disposal activities there is a risk of sustaining injuries caused by rough, sharp surfaces of transport crates, boxes, pallets or packaging aides.

Wear safety gloves to avoid injuries by cutting.

### WARNING



General risk of injury from sharp edges.

The *rolling system* is made of various materials (e.g. nickel), which can trigger an allergic reaction.

Wear protective gloves and protective eyewear when using the *rolling systems*.

The weight of the *rolling system* may cause harm when it falls down.

General risk of injury during transportation/lifting of the *rolling system*.

- Ensure that the *rolling system* is protected of falling down or tipping over.
- Wear safety boot/hard-toed boot at all times.
- Use suitable hoisting devices.

## 6.1 Removing the *rolling system* from the processing machine

### WARNUNG



Risk of burns from the hot surface of the *rolling system*.

Only remove the *rolling system* after the *rolling system* has cooled down.

Risk of cuts due to chips adhering to the *rolling system*.

Remove any chips adhering to the system from the *rolling system* before removing the rolling system from the processing machine.

1. Check if you need suitable hoisting device.

- We advise to use suitable hoisting device when lifting the *rolling system* from a weight of 5 kg | 11 lb.



### NOTE

Suitable hoisting devices are for example:

- A sling
- Hoisting Chain
- Lift cable.

Please contact your occupational safety specialist before transporting the *rolling system*.

2. Make sure that the *rolling system* or components do not fall down.

3. Unclamp the *rolling system* in the processing machine.

4. Remove the *rolling system*.

## 6.2 Removing the rolls

1. Loosen the clamping screw (3) and remove the roll axis (2).

2. Hold the rollers (8) with your hand to secure them.

3. Remove the rolls.



### NOTE

Use only rolls with the same roll set number (profile dimension, rolling head type, roll code number, roll width and roll version).

Be sure to lubricate the roll bores and the roll axis with molybdenumsulfide grease (e.g. Molykote).

After changing the rolls, check the rolled profile. If the external diameter is not correct, compensate this by making changes to the rolling head settings.

## 6.3 Removing the rolling head holder

1. Push the button on the shaft (11) and pull the shaft (11) out of the holder.

2. Remove the rolling head.

3. Reinsert the shaft (11) into the rolling head holder.

## 7 Wear parts, parts list

### Wear parts



#### NOTE

Wear parts are

- Roll set (6)
- Roll axis (2)

Please contact the operator if you notice wear or wear on a component of the *rolling system*.

### Parts list



#### NOTE

When ordering spare parts be sure to state the ID number.

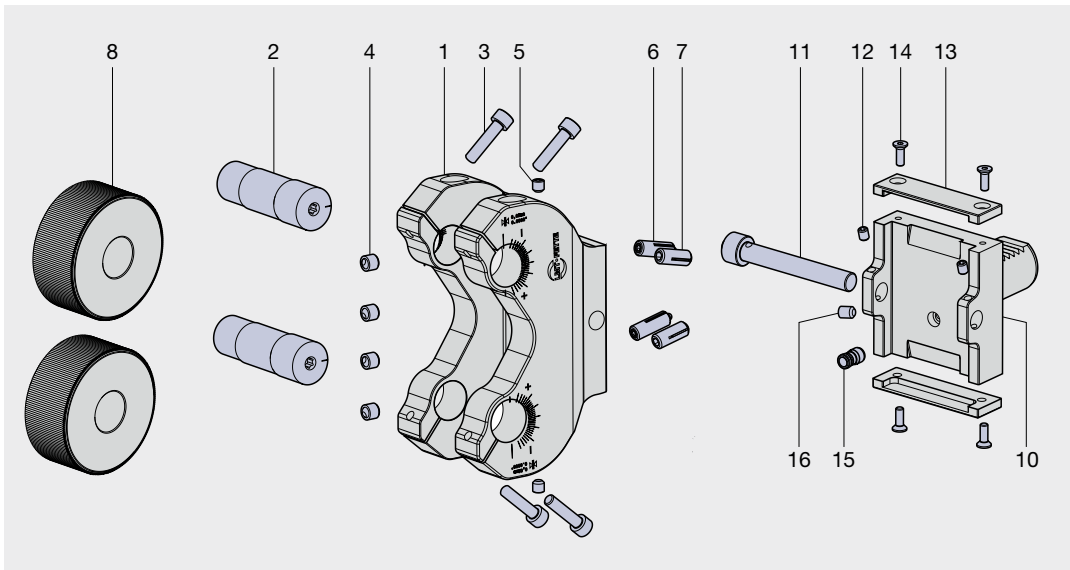


Figure 20: Exploded view TK1 – TK6 EVO

The following ID numbers are used in the standard TK EVO *rolling systems*.

Rolling Head			TK1 EVO	TK2 EVO	TK3 EVO	TK4 EVO	TK5 EVO	TK6 EVO
Part No.	Qty.	Designation	Ident No.					
			7368881	7368882	7368883	7368884	7368885	7368886
1	1	Body	7351126	7351138	7351139	7351123	7351140	7351142
2	2	Roll axis	7351151	7351152	7351150	7351143	7351143	7351143
3	4	Clamping screw roll axis	7370076	2900634	7370064	7370065	2142023	2142023
4	3	Nozzle	7045437	7210132	-	-	-	-
4	4	Nozzle	-	-	7210132	7210132	7210132	7210132
5	2	Coolant channel plug screw	7337739	2142073	2142073	2142073	2142073	2142073
6	2	Spring plunger	7294245	7294245	7366490	7366490	7366490	7366490
7	2	Pendulum stop	-	7356491	7356491	7356491	7356491	7356491
8	2	Roll	individual					
9	2	Setting gauge	individual					
10	1	Body holder	individual					
11	1	Shaft	7294597	7294297	7294397	7294497	7294597	7294597
12	2	Screw pin	2142067	2142056	2142067	2142067	2142067	2142067
13	2	Chip guard	individual					
14	4	Clamping screw chip guard	2141236	2141236	2141236	2141236	2141236	2141236
15	1	Coolant connection pipe	7351144	7351144	7351144	7351144	7351144	7351144
16	1	Plug screw for holder	2142074	2142074	2142074	2142074	2142074	2142074

Table 10: Components of the rolling system TK1–TK6 EVO

## 8 Maintenance

### Maintenance

Daily:

Check all components of the *rolling system* for wear and damage.

Weekly:

1. Follow the instructions in chapter 6.
2. Follow the instructions in chapter 4.

### Maintenance when replacing the roll set

1. Follow instructions in chapter 6.
2. Follow instructions in chapter 4.

### Maintenance intervals

Be sure do adhere to the maintenance intervals listed in table 11. If the *rolling system* is used under more difficult conditions, the cleaning and maintenance intervals must be shorter.

Interval	Activity	Desription
Weekly (preferable daily)	Machine operator	Check the rolls for wear or toher damages. Clean the rolls from chips.
Weekly	Machine setter	Lubricate the rolls and the roll axis with molybdenumsulfide (e. g. Molykote).

Table 11: Cleaning and maintenance intervals

## 9 Storage



### NOTE

The storage state is the condition upon delivery.

1. Follow the instruction in Chapter 6.
2. Conserve the *rolling system*.
3. Store the *rolling system*.

Storage temperature: -10 °C maximal +30 °C

Relative humidity: < 60 %



## 10 Disposal



### NOTE

Dispose the *rolling system* with harmful coatings such as oils and fats properly. Improper disposal of the used materials is harmful to the environment. When you dispose materials, comply with national and local regulations.

Ensure that all national and local safety requirements are met:

- After discarding the rolling head, sorted disposal must be performed.
- Separate iron, non-ferrous metals, etc.
- Grease, oils and objects and lines which are soiled with grease or oil must be disposed separately.

## 11 Troubleshooting



### NOTE

Perform a visual and functional inspection prior to each troubleshooting.

Fault	Cause	Solution
1 Conical profile	Rolling head holder worn out	Replace the rolling head holder with a new holder
	Roll axis worn	Replace roll axis if wear $\varnothing > 0.03$ mm
	Misalignment of head and part ( $\geq 0.2$ mm error)	Realign rolling system and part
	Blank diameter tapered	Manufacture a cylindrical blank diameter
2 Profile out of tolerance	Incorrect rolling head setting	Renew rolling head set up
	Incorrect blank diameter (too big/too small)	Accurate pre-machining
3 Pitch error	Misalignment of head and part ( $\geq 0.2$ mm error)	Realign rolling system and part
	Wrong roll	Use correct roll
	Material not rollable	Check and follow (chapter 5.4)
	Incorrect feed	Choose feed rate according to chapter 5.2
4 Roll breakage	Inappropriate chamfer	Chamfering according to chapter 5.1
	Blank diameter too big	Accurate pre-machining of blank diameter (chapter 5.1)
	Rolling head setting too tight	Adjust the rolling head (chapter 4.3)
	Misalignment	Realign the machine
	Material too hard	Only roll on materials with max. material strength of 1000 N/mm <sup>2</sup> or lower
	Too much material transforming	Choose bigger rolling head
	Rolled with overload	Adjust the rolling head (chapter 4.3)
5 Extended roll wear	Material with bad rollability	Check and follow table 8
	Examination of rolling speed	Check and follow table 8
	Elongation properties inadequate	Choose different material
	Not enough coolant	Start using coolant, readjust coolant nozzles, increase coolant pressure
6 Profile not smooth	Inappropriate chamfer	Chamfering according to chapter 5.1
	Workpiece deflection	Increase workpiece support
	Inappropriate chamfer	Chamfering according to chapter 5.1
	Rolling speed too large or too small	Check and follow table 8
Too much or too little power for pushing on to the workpiece	Adjust the pressing/psuhsing force	

Table 12: Troubleshooting

**Publication details**

Publisher: LMT Fette Werkzeugtechnik GmbH & Co. KG, Grabauer Strasse 24, 21493 Schwarzenbek, Germany, Phone: +49 41 51 12-0  
Design: deckermedia GbR, Rostock

© by LMT Fette Werkzeugtechnik GmbH & Co. KG

This publication may not be reprinted in whole or part without our express permission. All right reserved. No rights may be derived from any errors in content or from typographical or typesetting errors. Diagrams, features and dimensions represent the current status on the date of issue of this catalog. We reserve the right to make technical changes. The visual appearance of the products may not necessarily correspond to the actual appearance in all cases or in every detail.

Sources: LMT Fette Werkzeugtechnik GmbH & Co. KG



We are committed to you worldwide!  
Contact us and our experts: [www.lmt-tools.com](http://www.lmt-tools.com)